
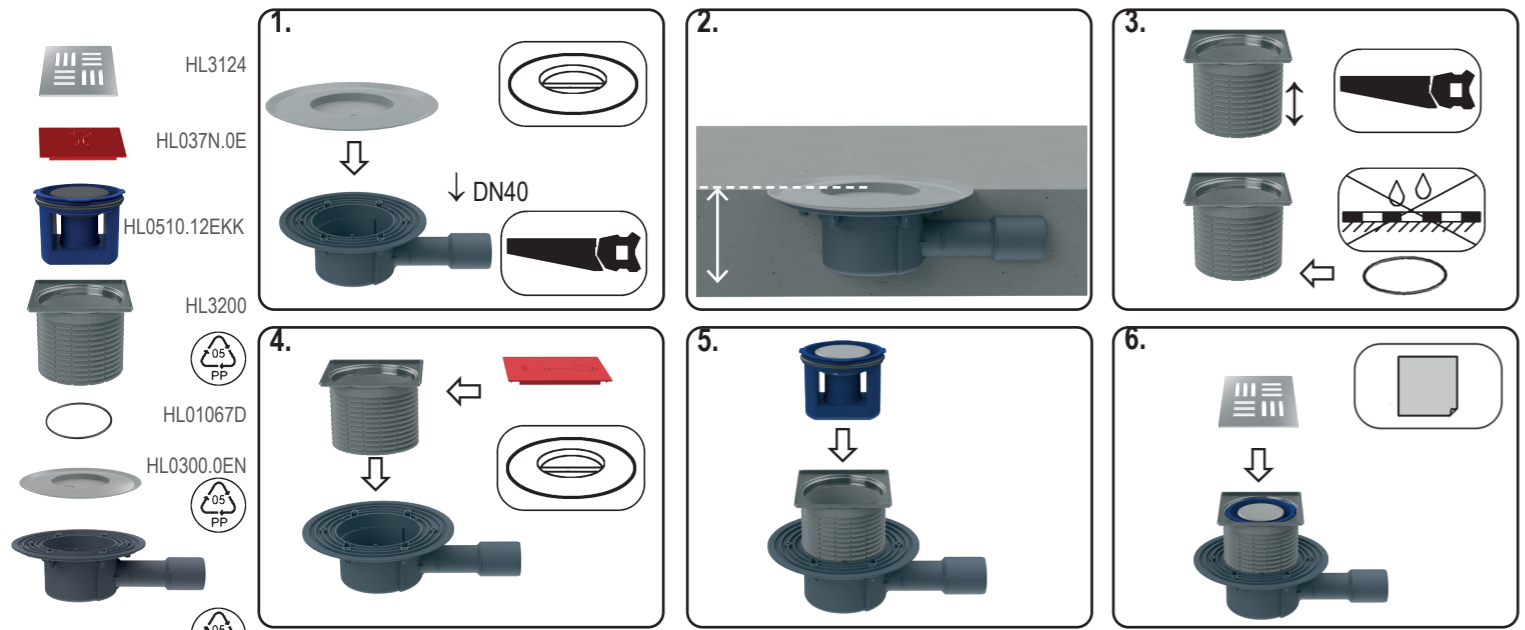




HL510Prblue-3124 < 0,50 l/sec DN 40/50



D BODENABLAUF **TR** YER SÜZGEÇİ
IT SCARICO A PAVIMENTO **CZ/SK** PODLAHOVÁ VPÚST
GB FLOOR DRAIN **HR** PODNI ODVOD
HU PADLÓLEFOLYÓ **RO** SIFON DE PARDOSEALĂ
PL WPÚST PODLOGOWY **RU** ТРАП
SI TALNI ODTOK **BG** ПОДОВ СИФОН

27.02.2024



HL510Prblue-3124 < 0,50 l/sec DN 40/50

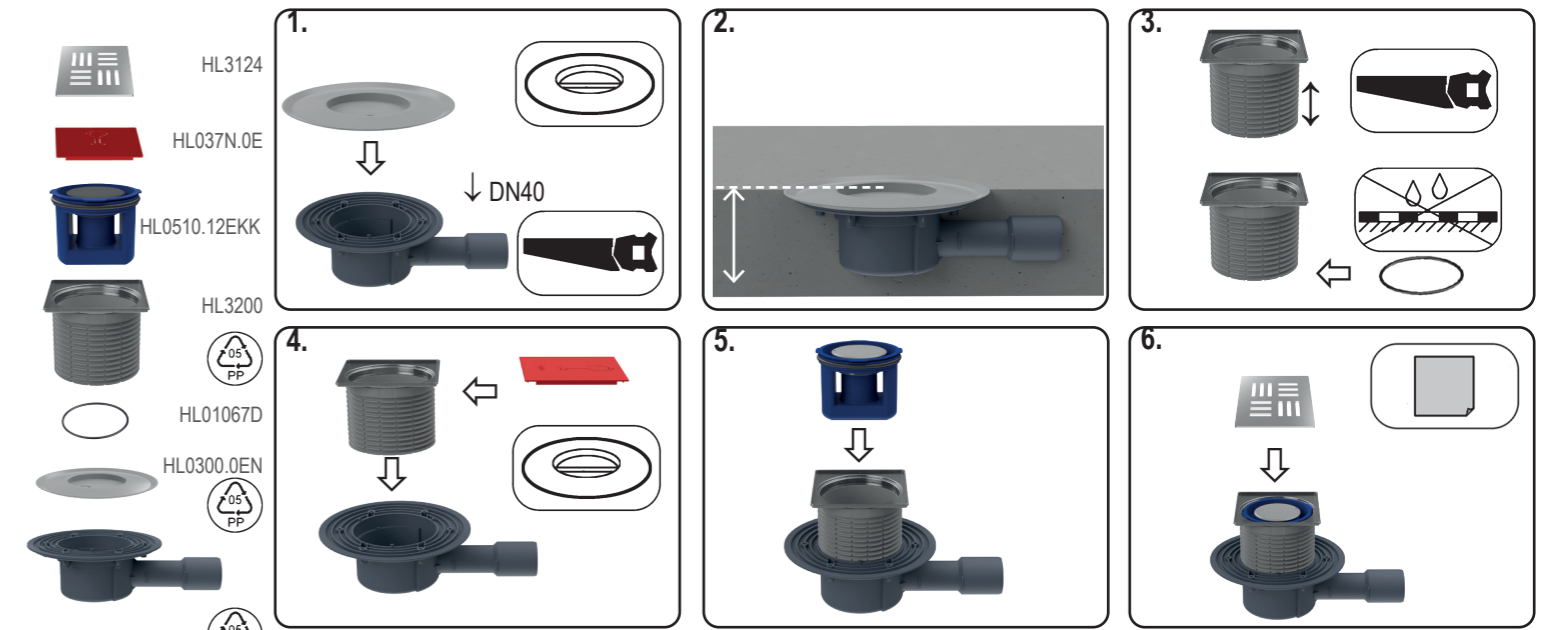

D BODENABLAUF **TR** YER SÜZGEÇİ
IT SCARICO A PAVIMENTO **CZ/SK** PODLAHOVÁ VPÚST
GB FLOOR DRAIN **HR** PODNI ODVOD
HU PADLÓLEFOLYÓ **RO** SIFON DE PARDOSEALĂ
PL WPÚST PODLOGOWY **RU** ТРАП
SI TALNI ODTOK **BG** ПОДОВ СИФОН

27.02.2024



HL510Prblue-3124 < 0,50 l/sec DN 40/50

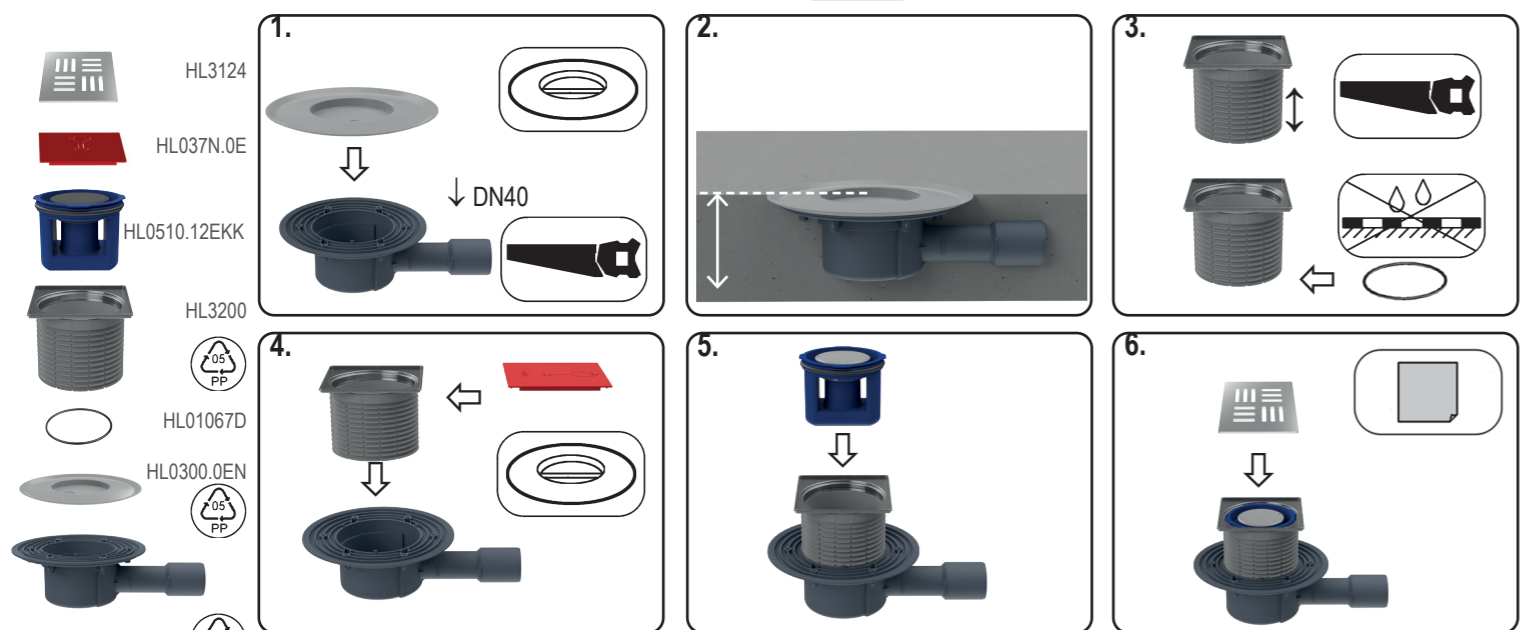

D BODENABLAUF **TR** YER SÜZGEÇİ
IT SCARICO A PAVIMENTO **CZ/SK** PODLAHOVÁ VPÚST
GB FLOOR DRAIN **HR** PODNI ODVOD
HU PADLÓLEFOLYÓ **RO** SIFON DE PARDOSEALĂ
PL WPÚST PODLOGOWY **RU** ТРАП
SI TALNI ODTOK **BG** ПОДОВ СИФОН

27.02.2024

HL510Prblue-3124 < 0,50 l/sec DN 40/50

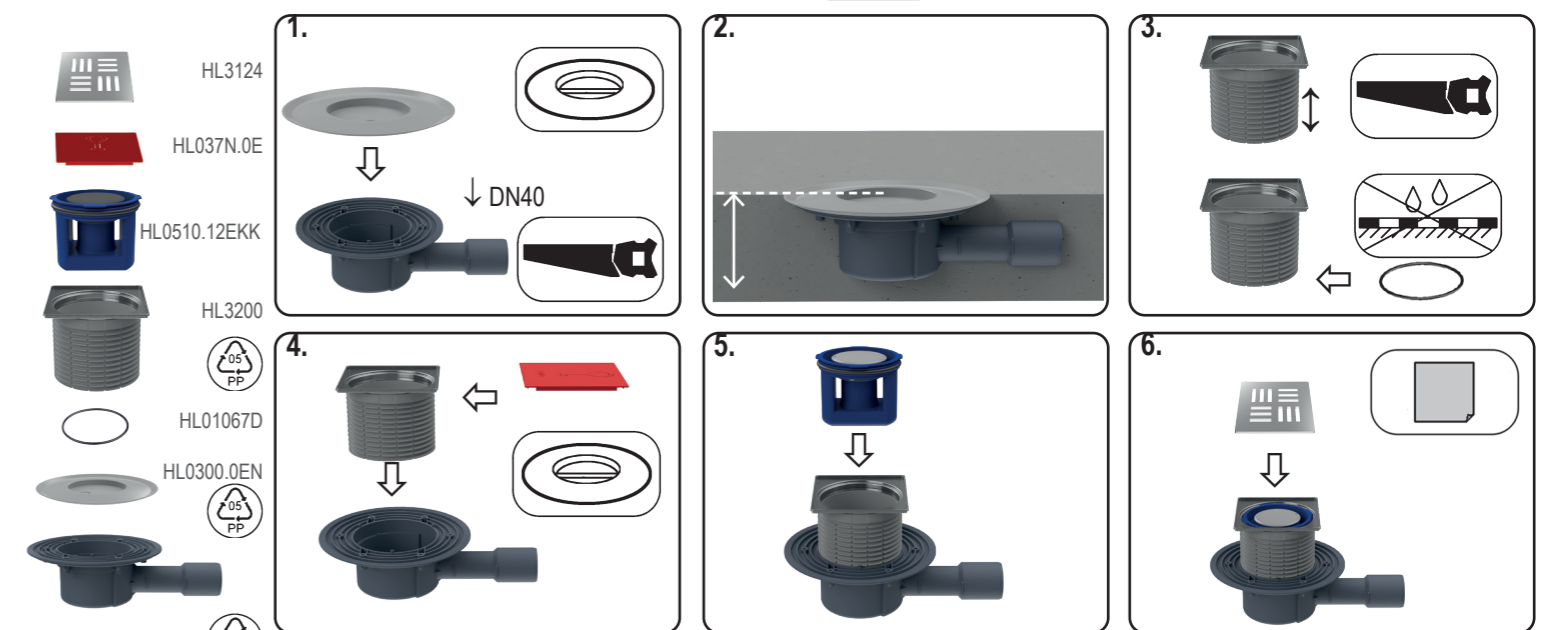

D BODENABLAUF **TR** YER SÜZGEÇİ
IT SCARICO A PAVIMENTO **CZ/SK** PODLAHOVÁ VPÚST
GB FLOOR DRAIN **HR** PODNI ODVOD
HU PADLÓLEFOLYÓ **RO** SIFON DE PARDOSEALĂ
PL WPÚST PODLOGOWY **RU** ТРАП
SI TALNI ODTOK **BG** ПОДОВ СИФОН

27.02.2024